

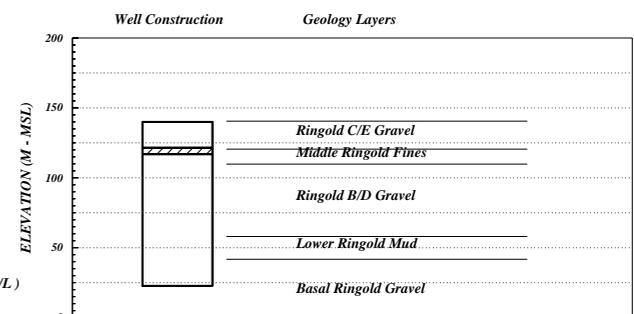
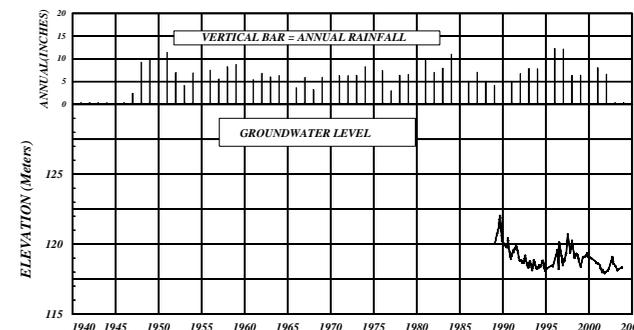
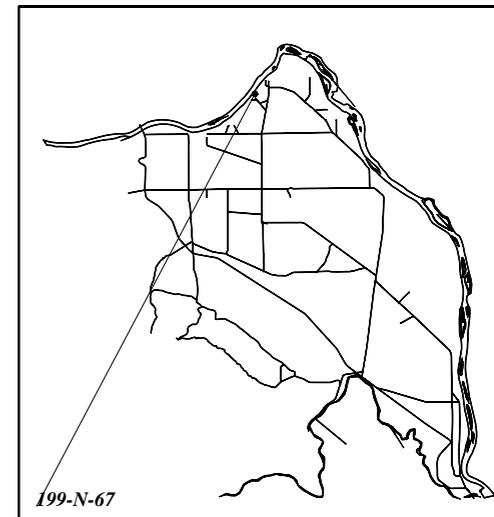


RADIONUCLIDES

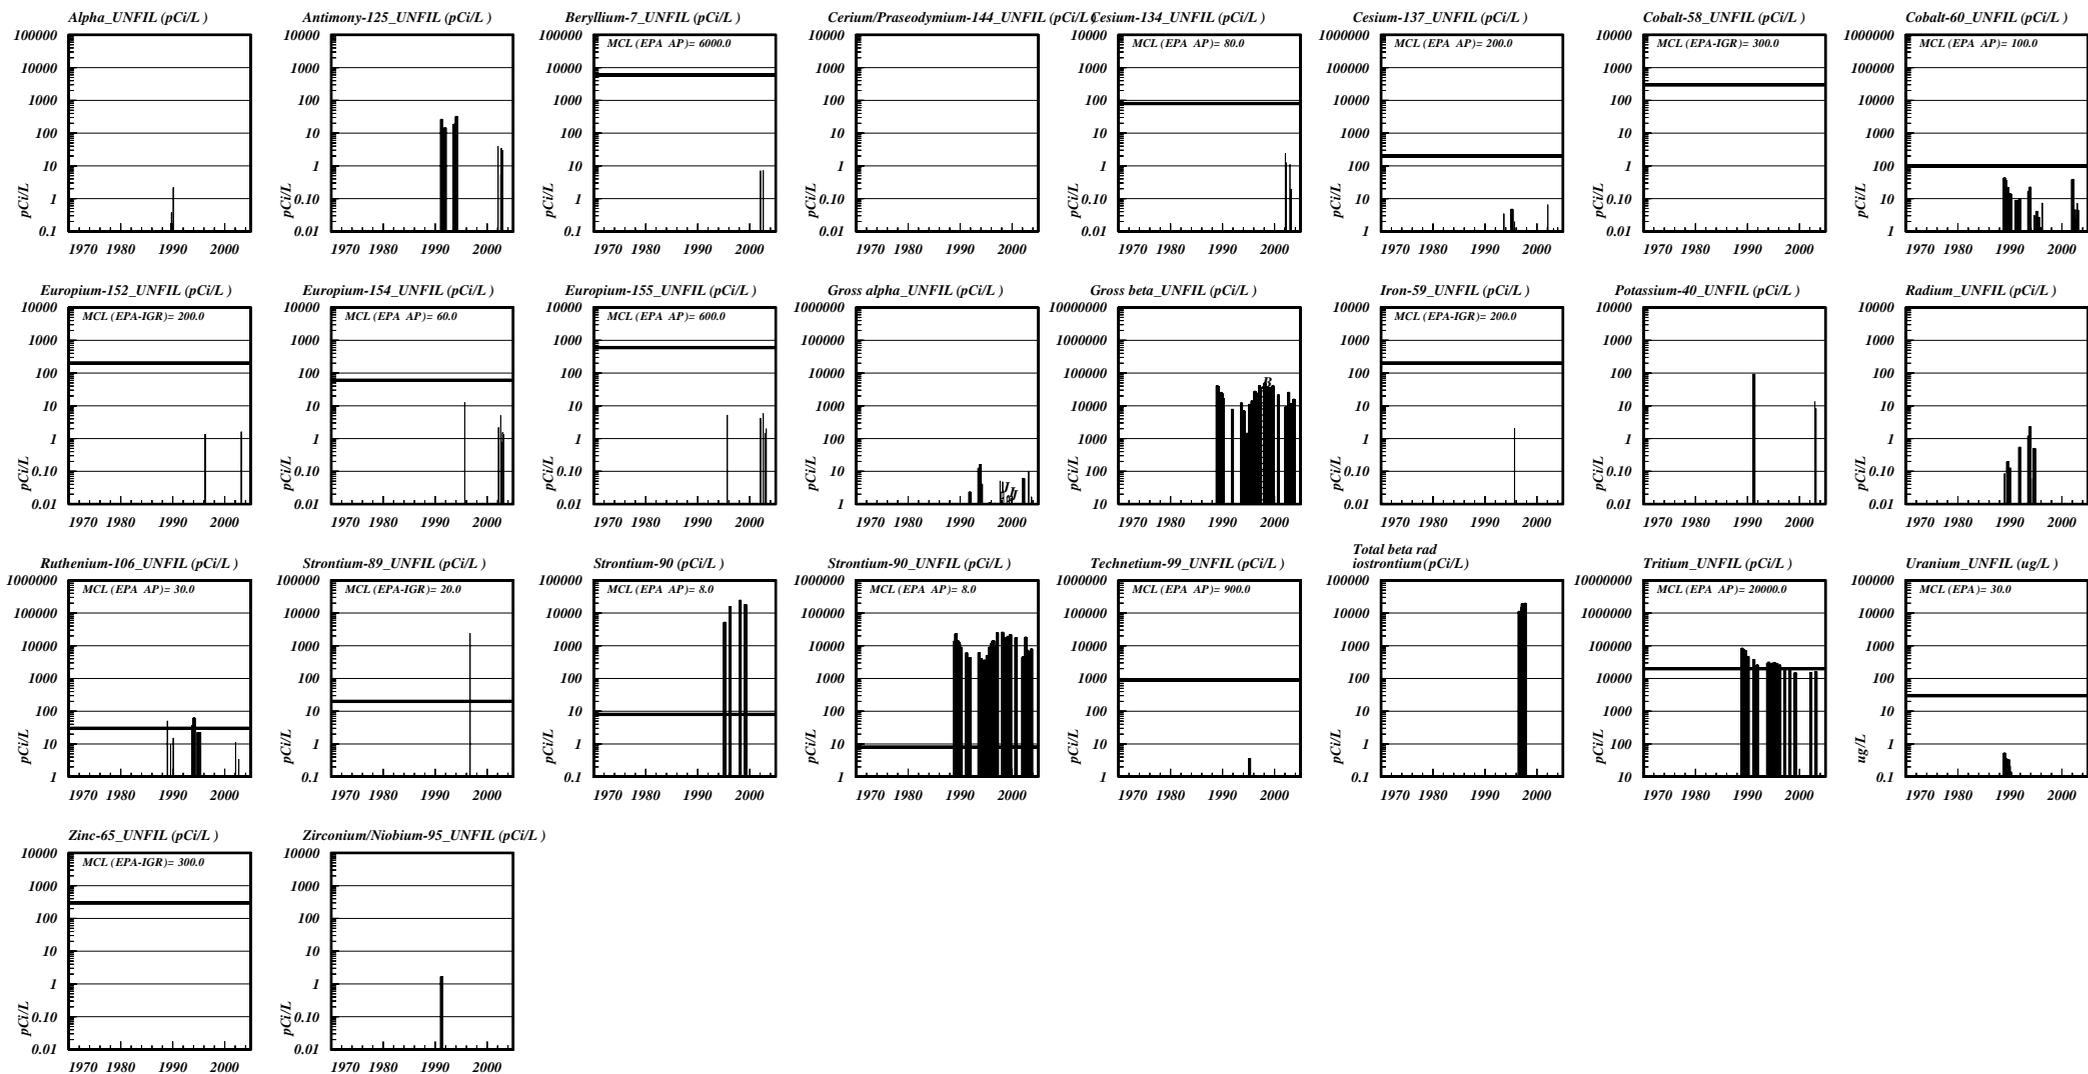

VOLATILE ORGANIC COMPOUNDS

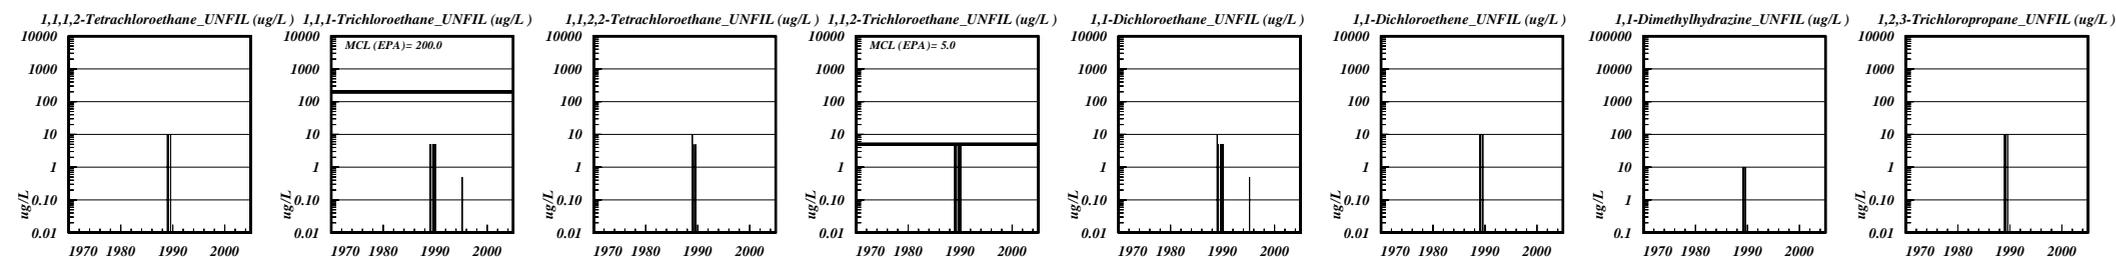


WELLNAME=199-N-67 WELLID=A4711

Well Type=STANDARD Well purpose=GROUNDWATER
 Owner=DOE Contact=BHI Well Adm Compliance=NON-COMPLIANT
 X_coord= 571494.20 Y_coord= 149799.00 Datum=NAD83(91) Date Survey= 1/15/1993
 Elevation= 140.006 Datum=NAVD88 Date Survey=01/20/93
 Ref_Point_Desc=BRASS CAP Ref_Point_side=NONE Contractor=USACE(JECA)
 Total Number of perforation Intervals=1
 NPERF#=1 Perf_top= 121.81 Bot= 117.24 MCas_size= 0.00 Perf_cuts= 0.00
 Total Number of Screen Intervals=1
 Screen#=1 Screen_diam= 6.00 in Top= 18.44 Bottom= 23.16 m Slot_size= 0.02 in
 Screen_material=Stainless Steel
 Total Number of Seals=5
 Seal#-1 Depth_top= 23.16 Bottom= 24.08 m Material=Backfill
 Seal#-2 Depth_top= 15.09 Bottom= 16.61 m Material=Bentonite Pellets
 Seal#-3 Depth_top= 6.10 Bottom= 15.09 m Material=Granular Bentonite
 Seal#-4 Depth_top= 16.61 Bottom= 23.16 m Material=Sand Pack
 More Information is at <http://www.envirodataaccess.com/wellfiles/199-N-67.htm>

LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value; L=Value between IDL and CRQL (estimated); T=Tentatively identified compound;
 EPA-IGR=EPA-Implementation Guidance for Radionuclides; WAC=Washington Administrative Code;

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit; THIN BARS=Value Below Detection Limit; HATCHED BARS=Value With Data Qualifier Flag


VOLATILE ORGANIC COMPOUNDS

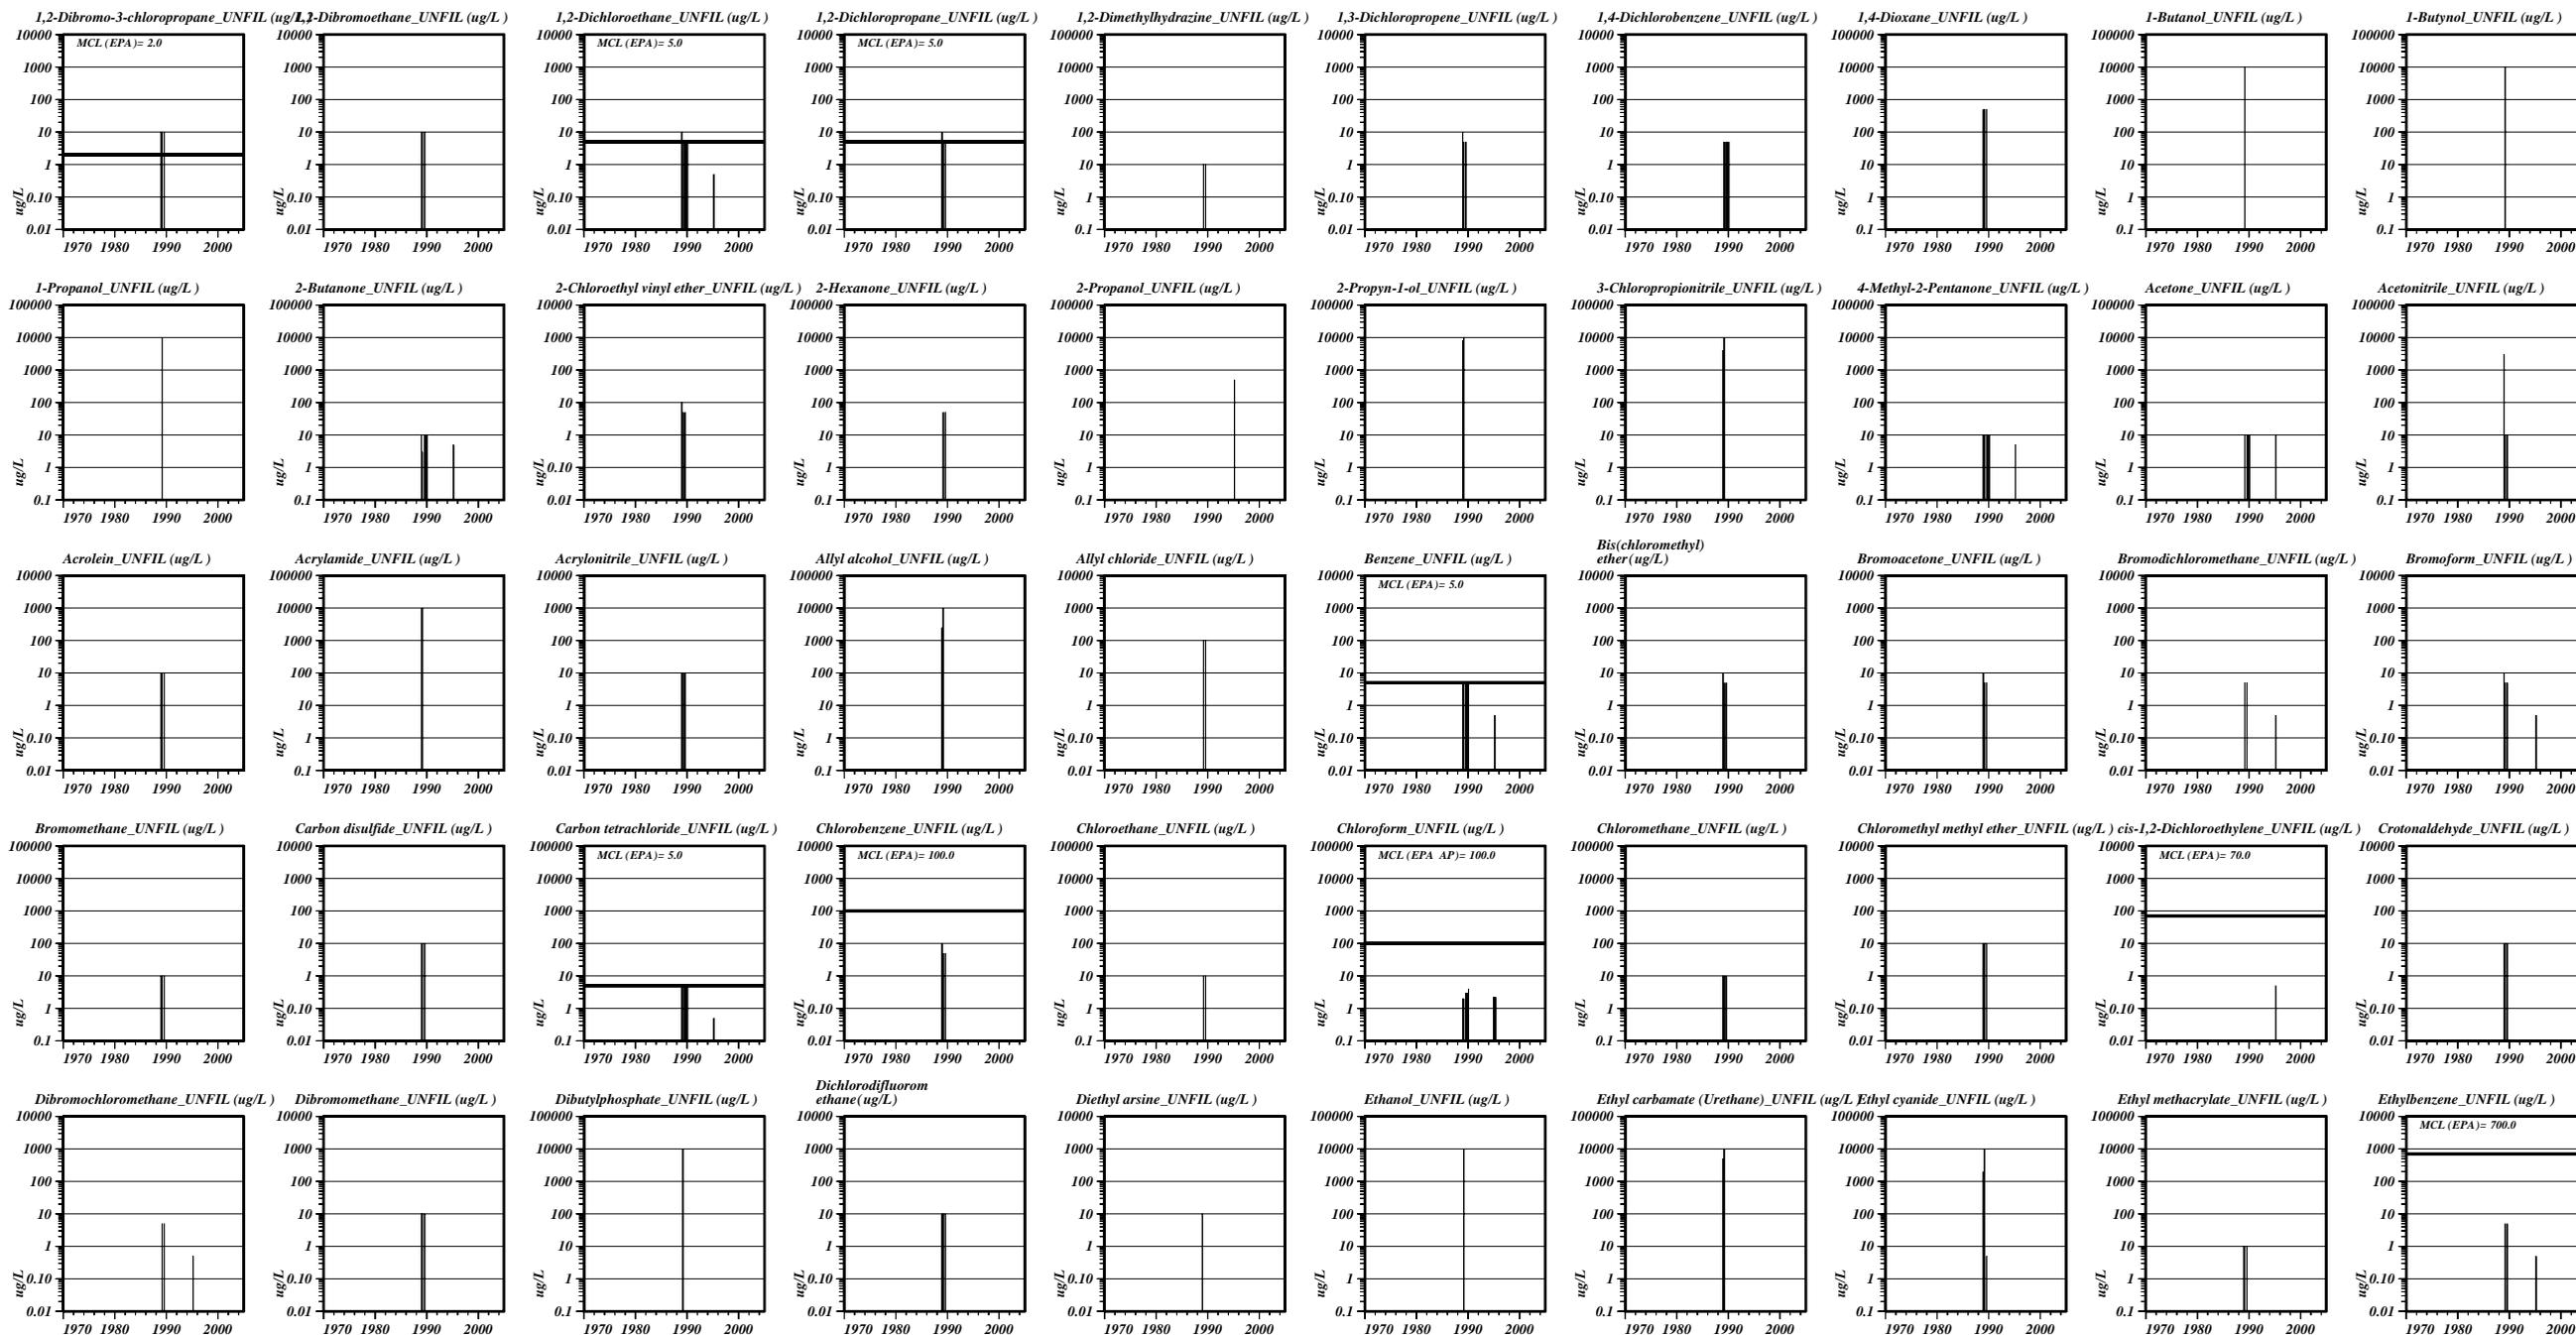


LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value:L=Value between IDL and CRQL (estimated):T=Tentatively identified compound:
 EPA-IGR=EPA-Implementation Guidance for Radionuclides: WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit:THIN BARS=Value Below Detection Limit:HATCHED BARS=Value With Data Qualifier Flag

VOLATILE ORGANIC COMPOUNDS

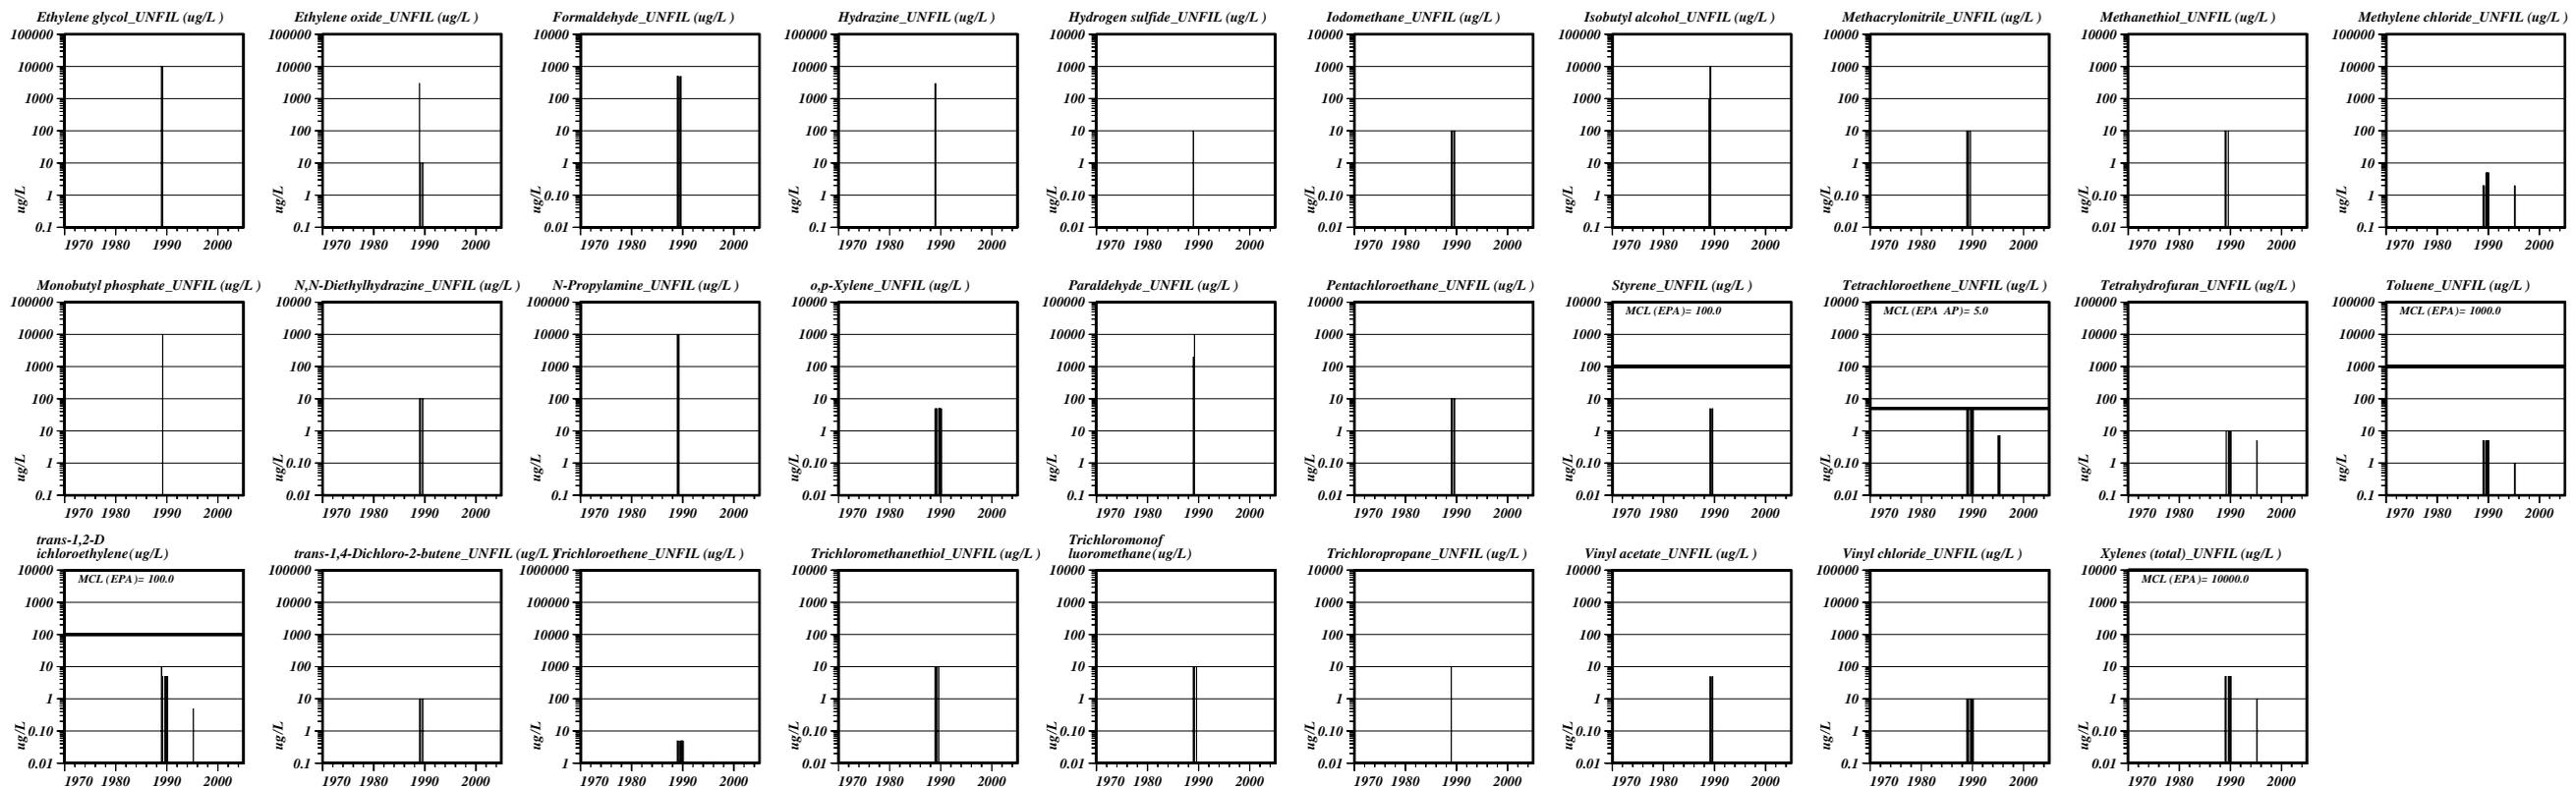


SEMI-VOLATILE ORGANIC COMPOUNDS

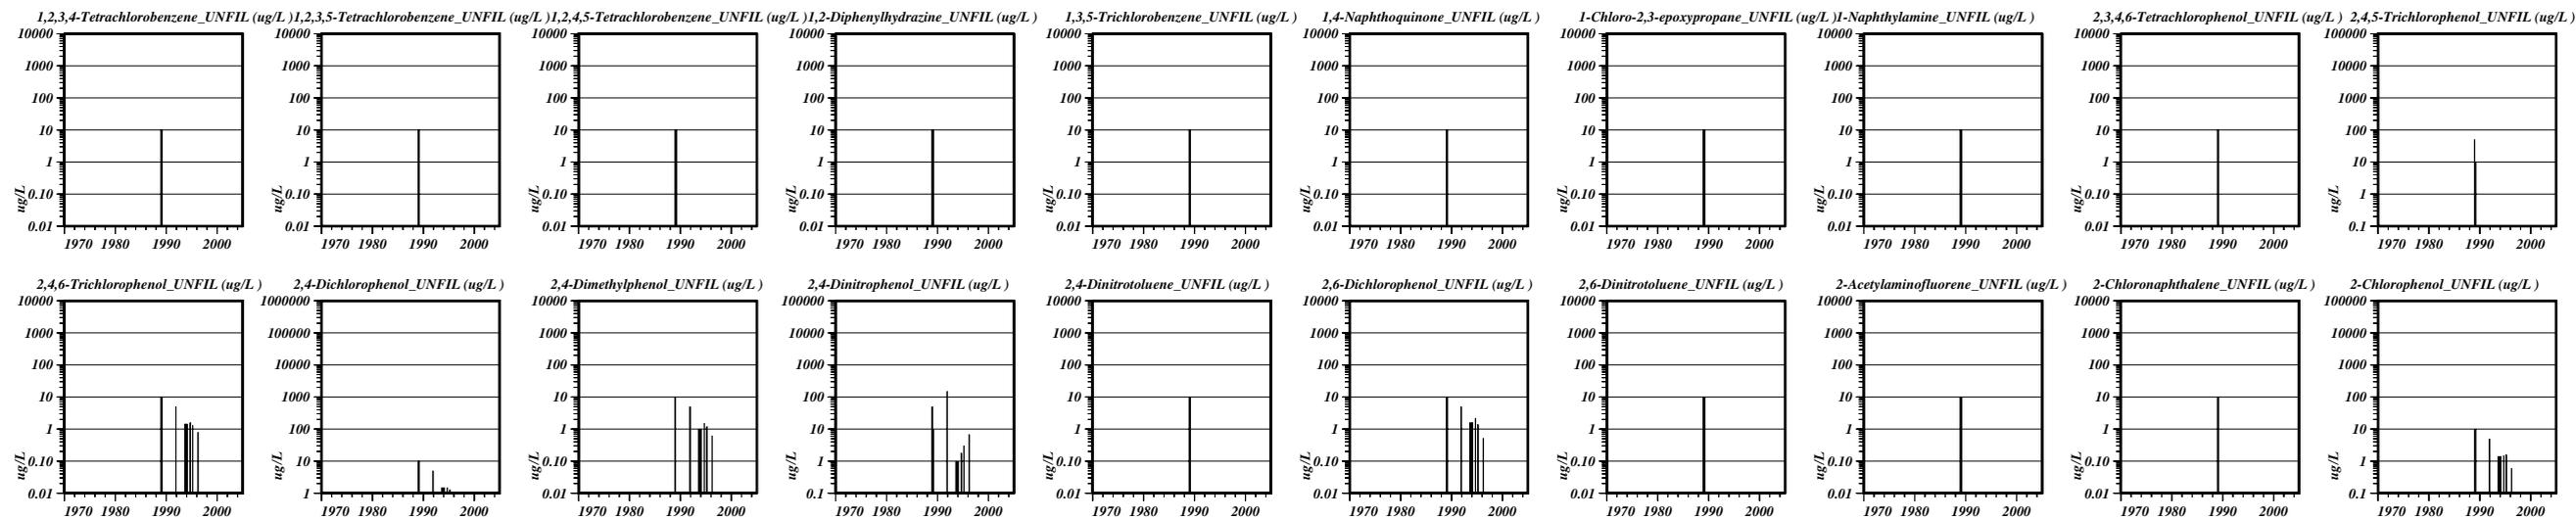

LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value; L=Value between IDL and CRQL (estimated); T=Tentatively identified compound; EPA-IGR=EPA-Implementation Guidance for Radionuclides; WAC=Washington Administrative Code;

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit; THIN BARS=Value Below Detection Limit; HATCHED BARS=Value With Data Qualifier Flag

SEMI-VOLATILE ORGANIC COMPOUNDS

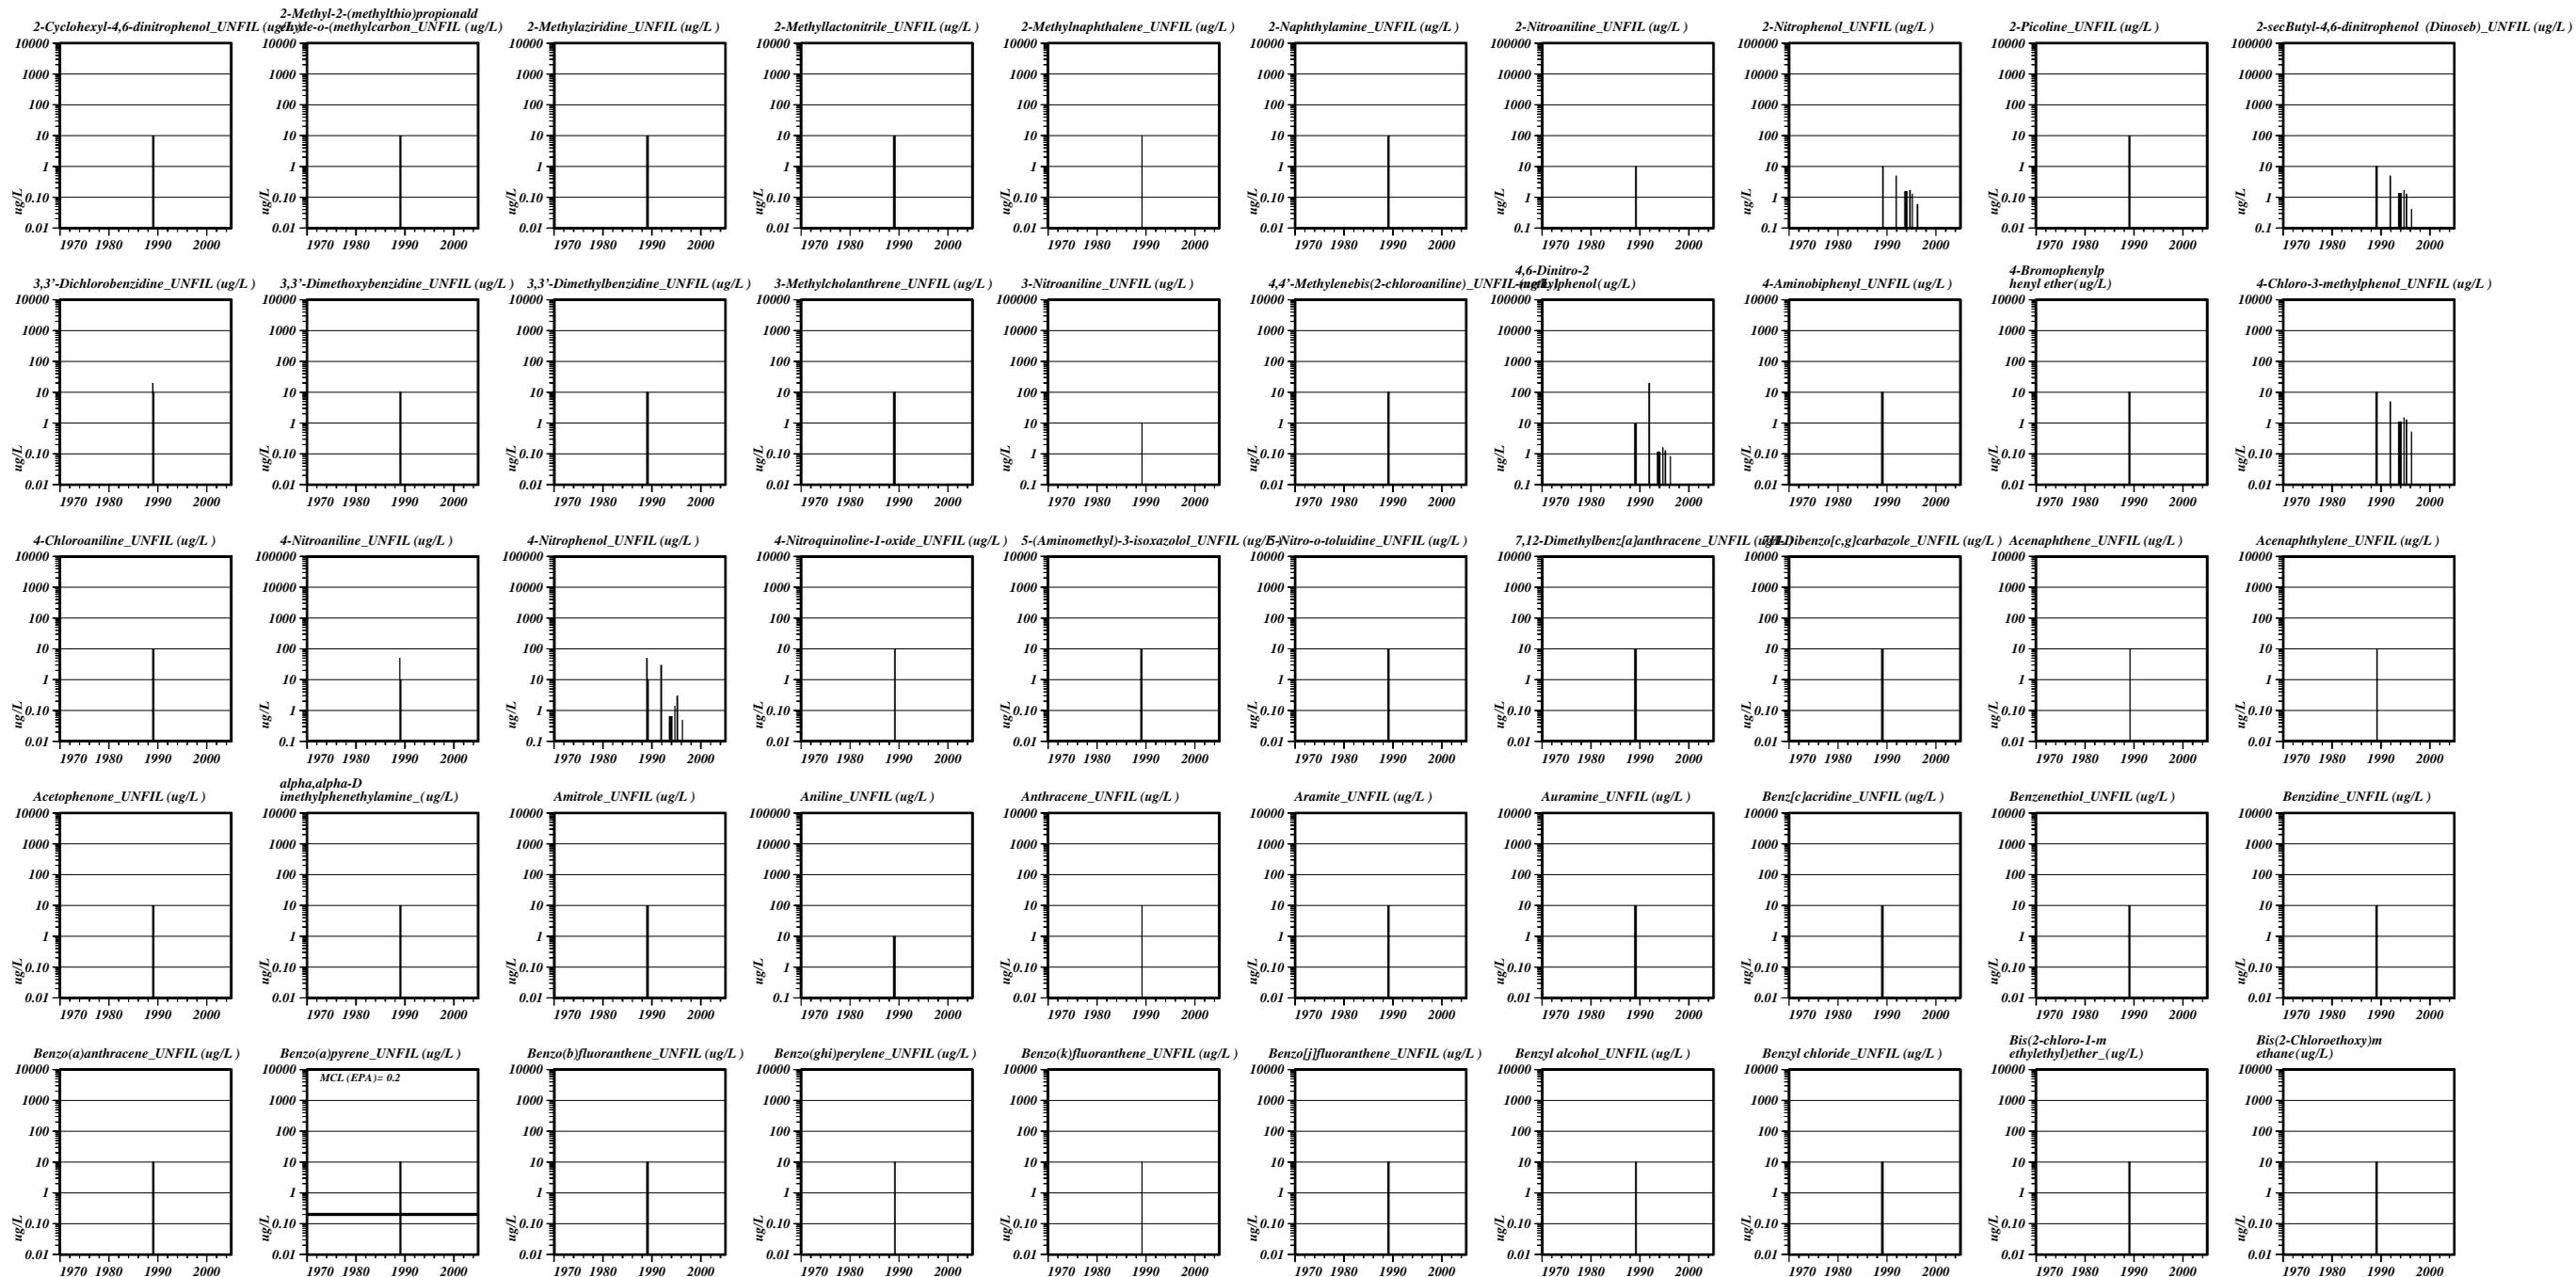


LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value:L=Value between IDL and CRQL (estimated):T=Tentatively identified compound:

EPA-IGR=EPA-Implementation Guidance for Radionuclides: WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit:THIN BARS=Value Below Detection Limit:HATCHED BARS=Value With Data Qualifier Flag

SEMI-VOLATILE ORGANIC COMPOUNDS

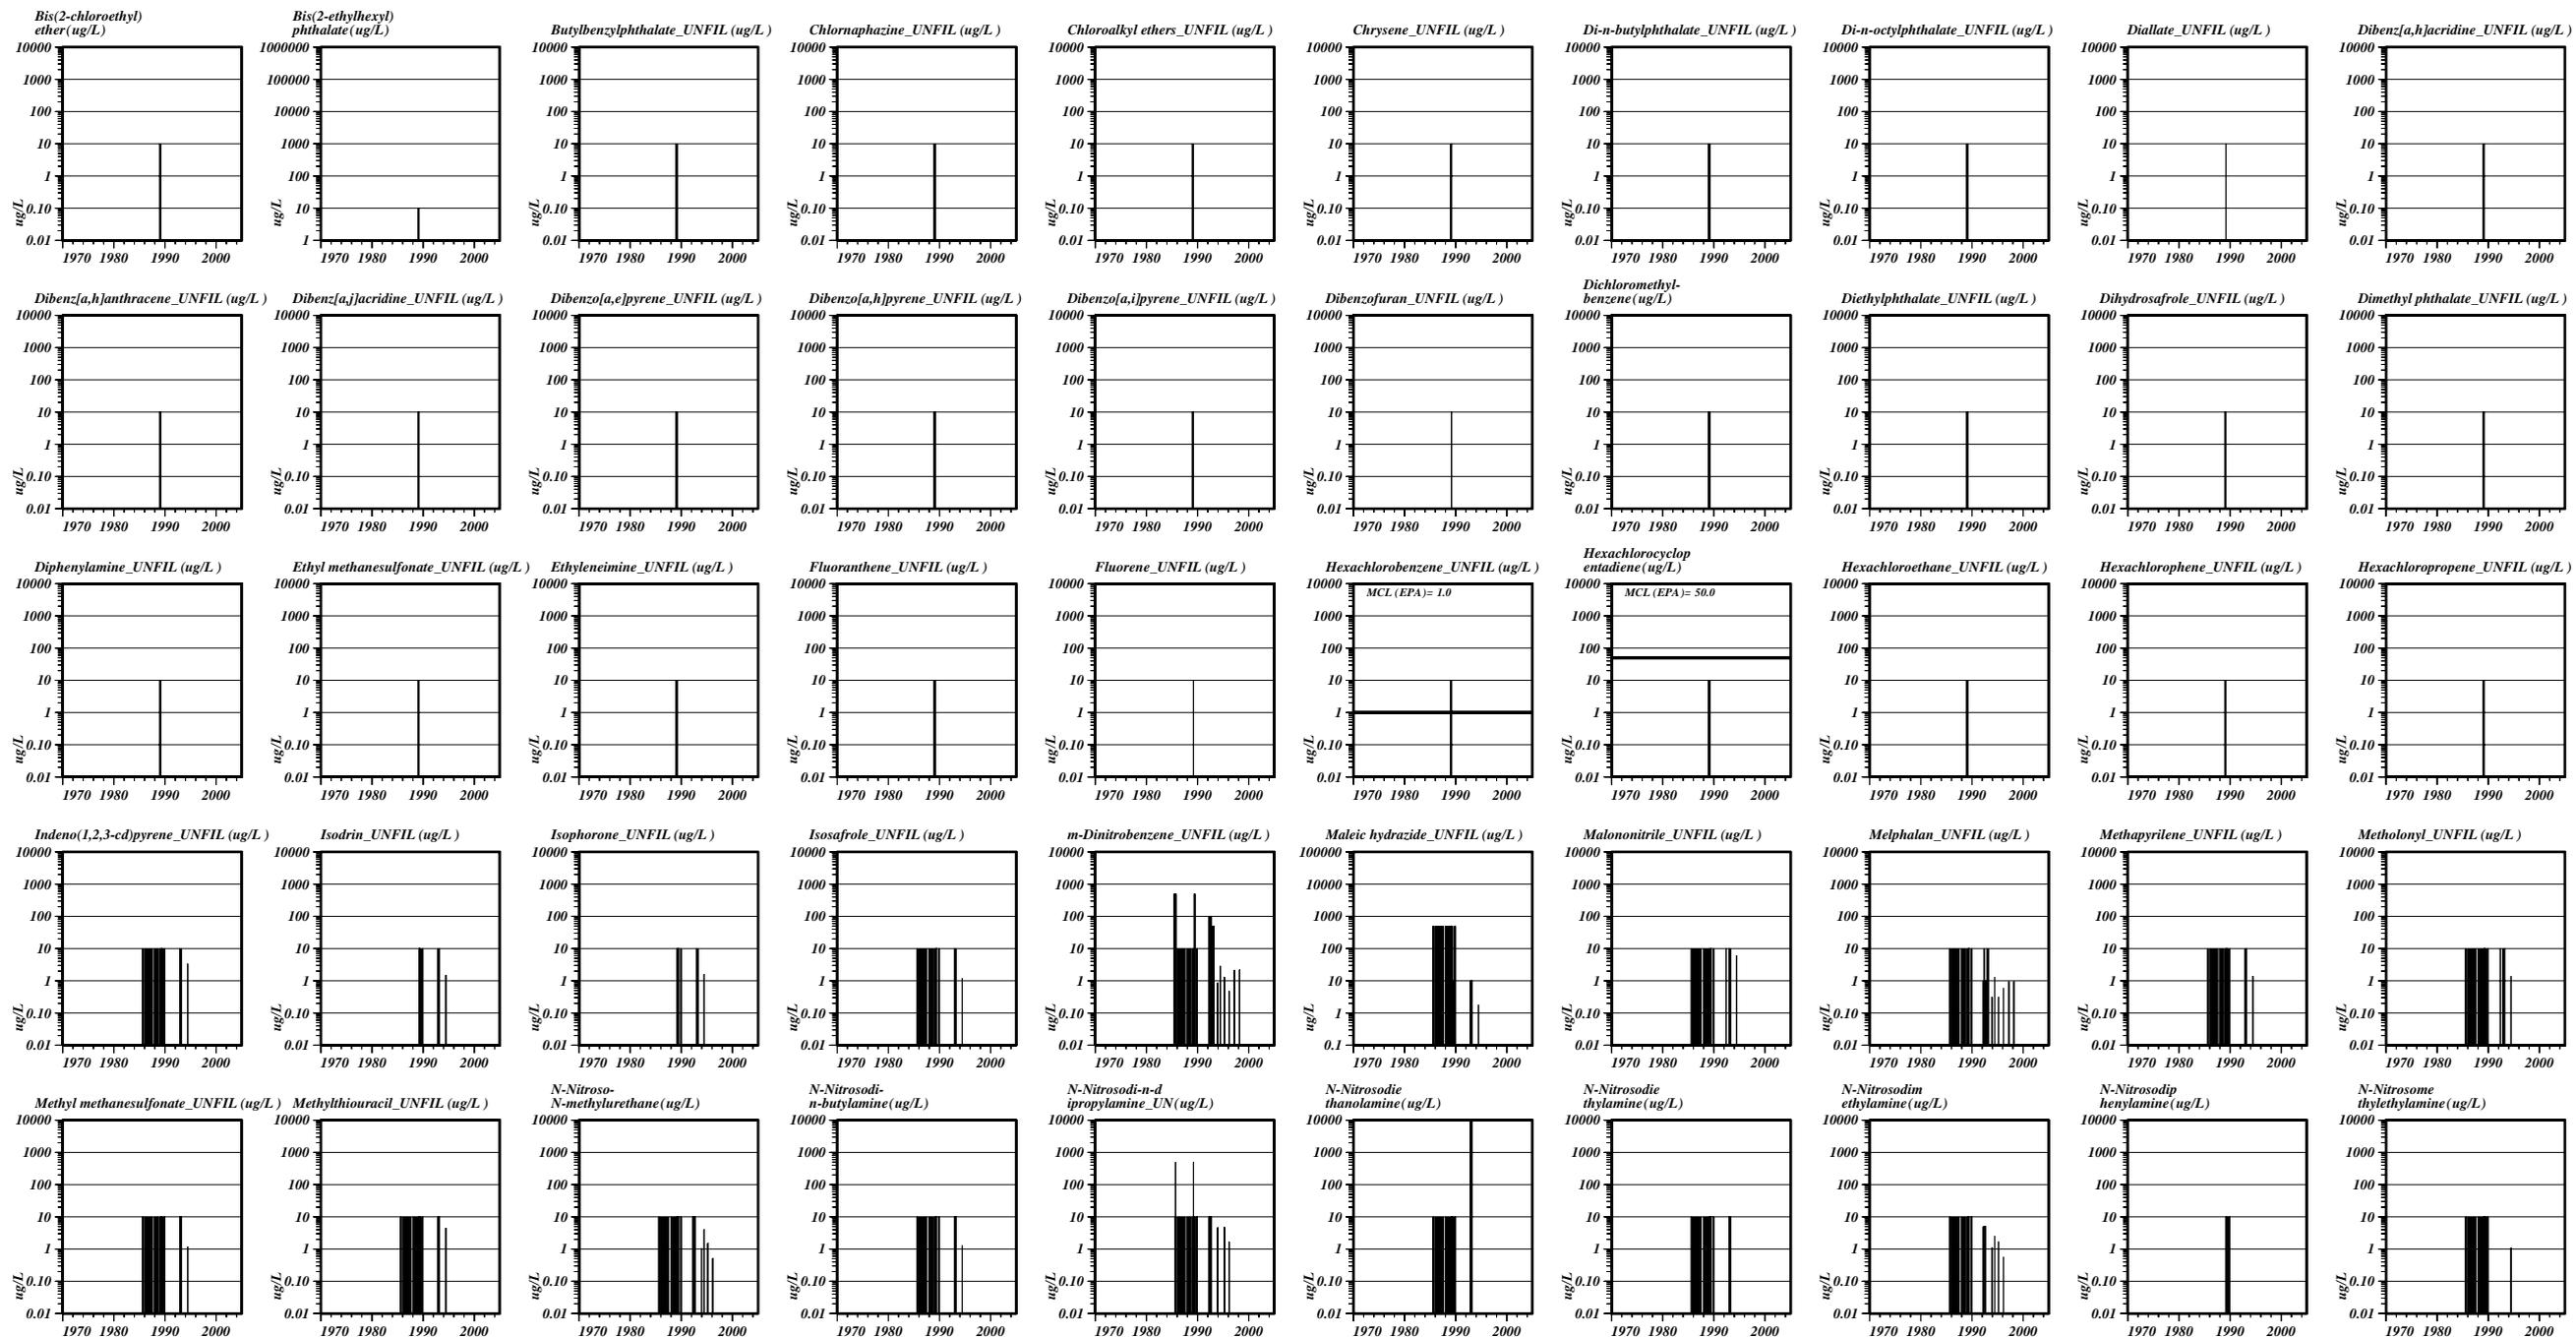


LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value:L=Value between IDL and CRQL (estimated):T=Tentatively identified compound:


EPA-IGR=EPA-Implementation Guidance for Radionuclides: WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit:THIN BARS=Value Below Detection Limit:HATCHED BARS=Value With Data Qualifier Flag

SEMI-VOLATILE ORGANIC COMPOUNDS

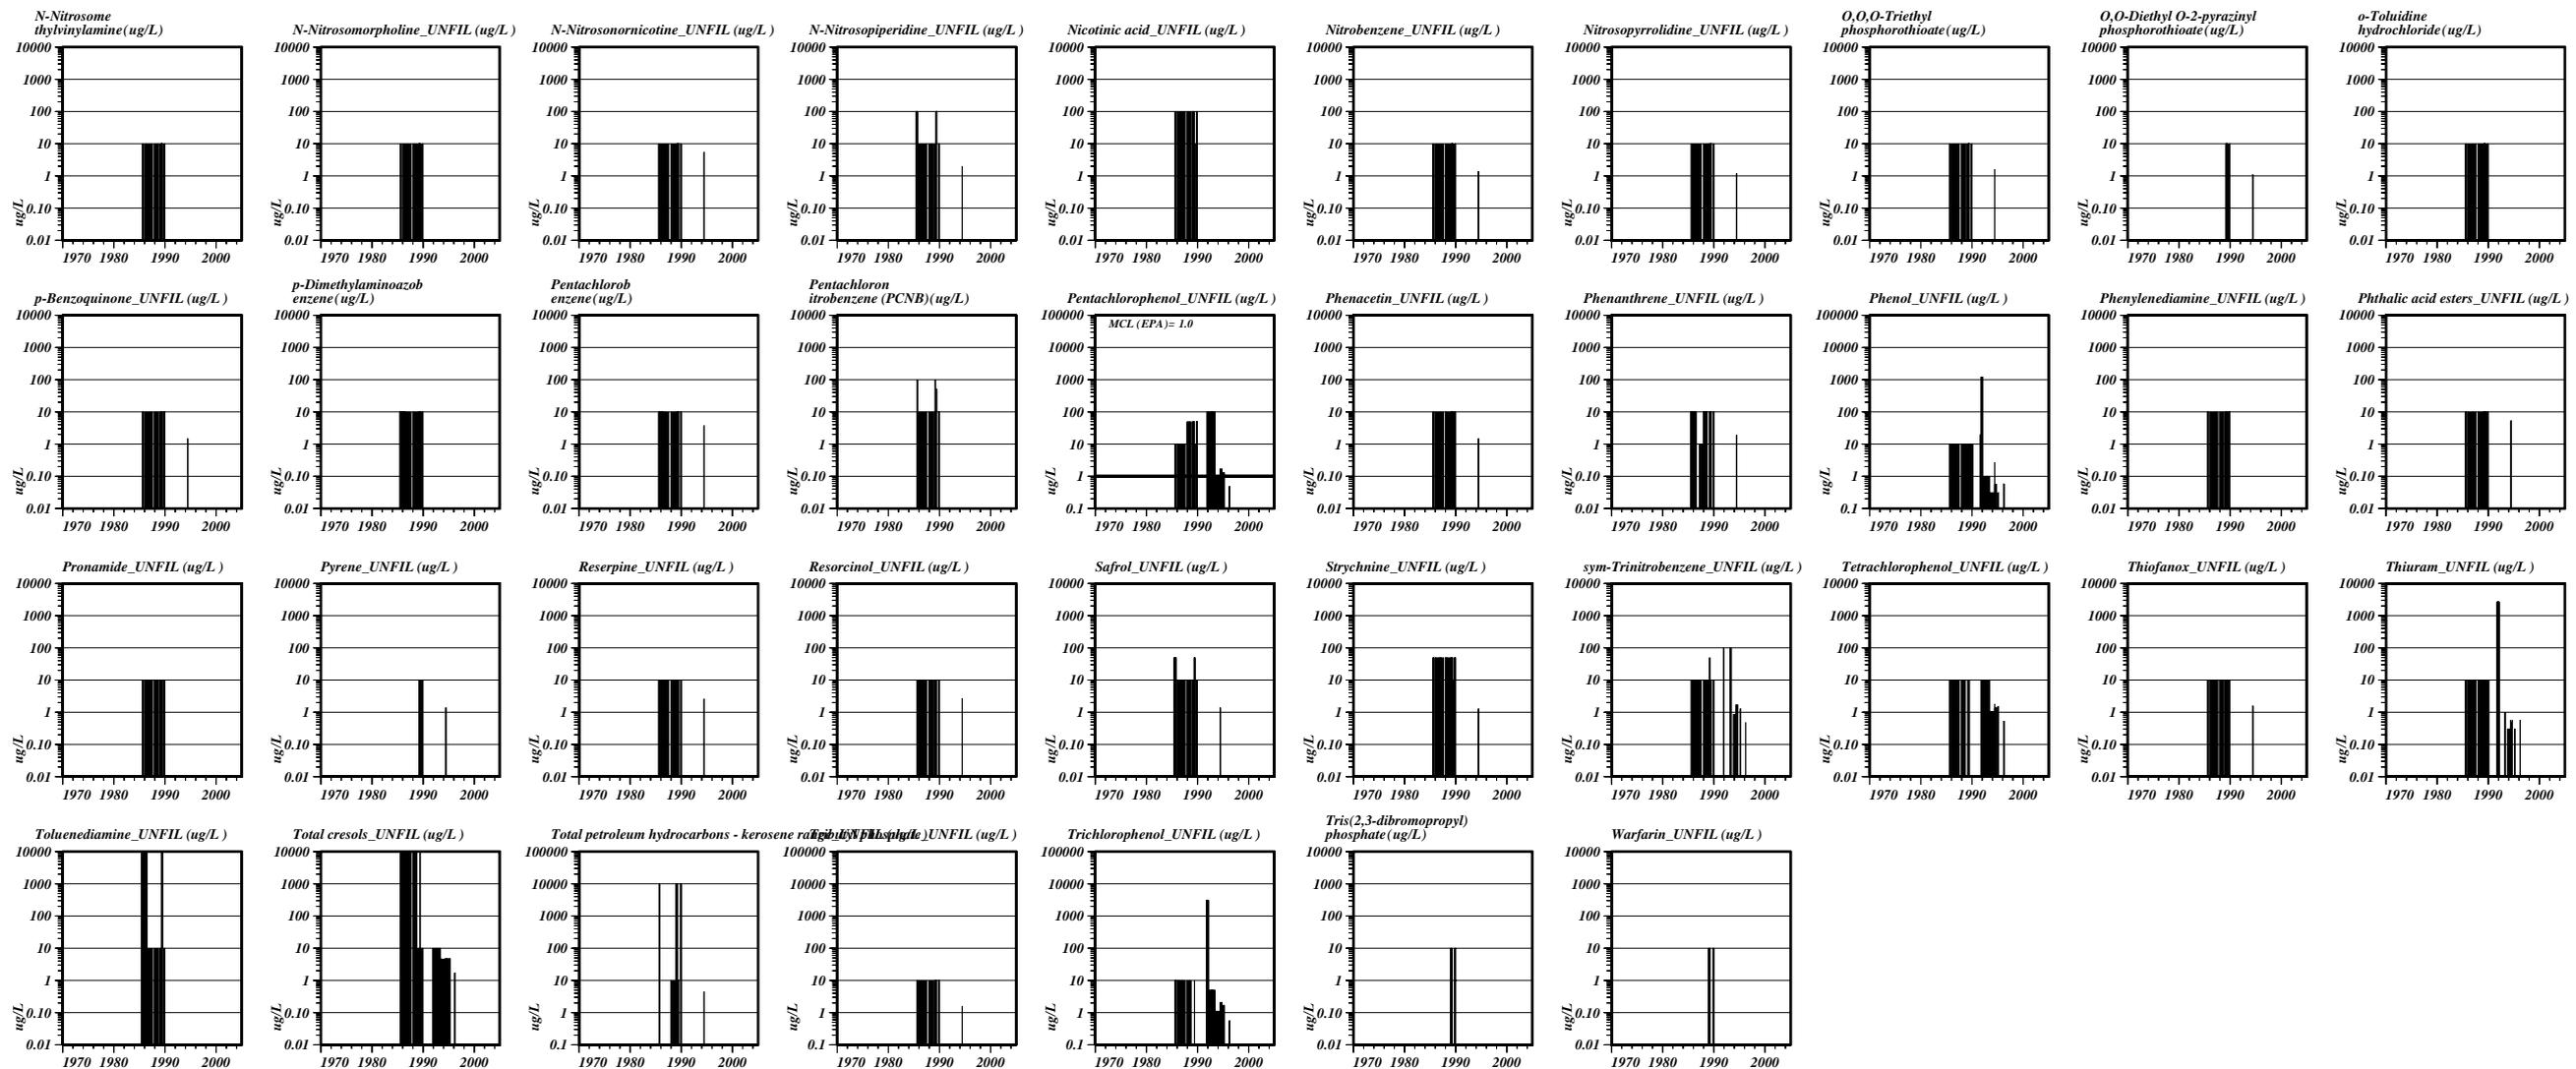


METALS & PHYSICAL PARAMETERS

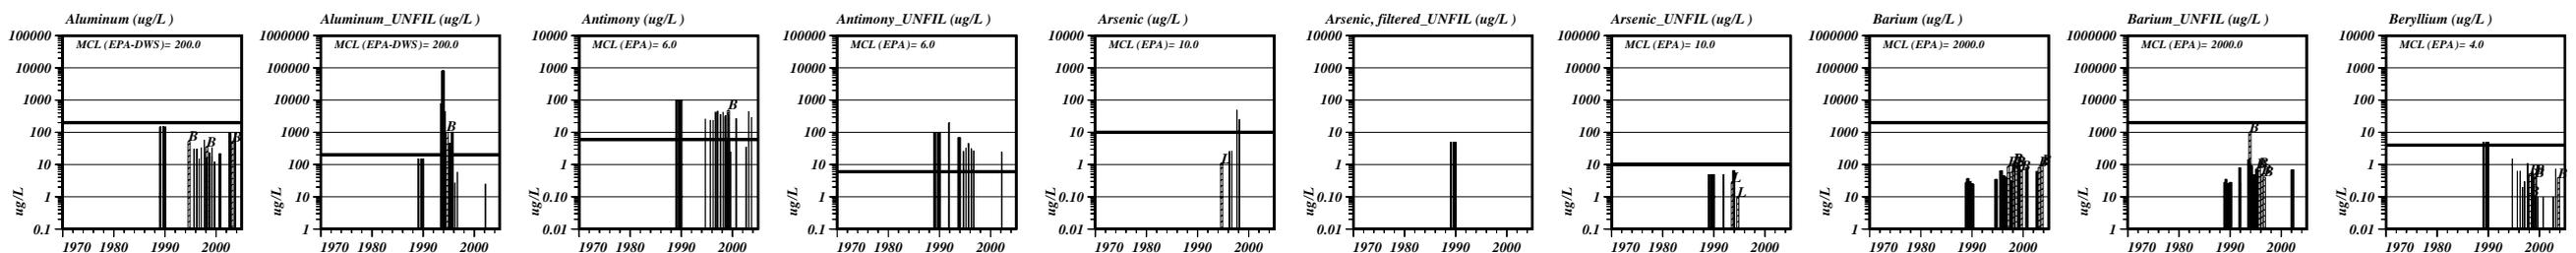

LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value:L=Value between IDL and CRQL (estimated):T=Tentatively identified compound:
EPA-IGR=EPA-Implementation Guidance for Radionuclides: WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit:THIN BARS=Value Below Detection Limit:HATCHED BARS=Value With Data Qualifier Flag


METALS & PHYSICAL PARAMETERS

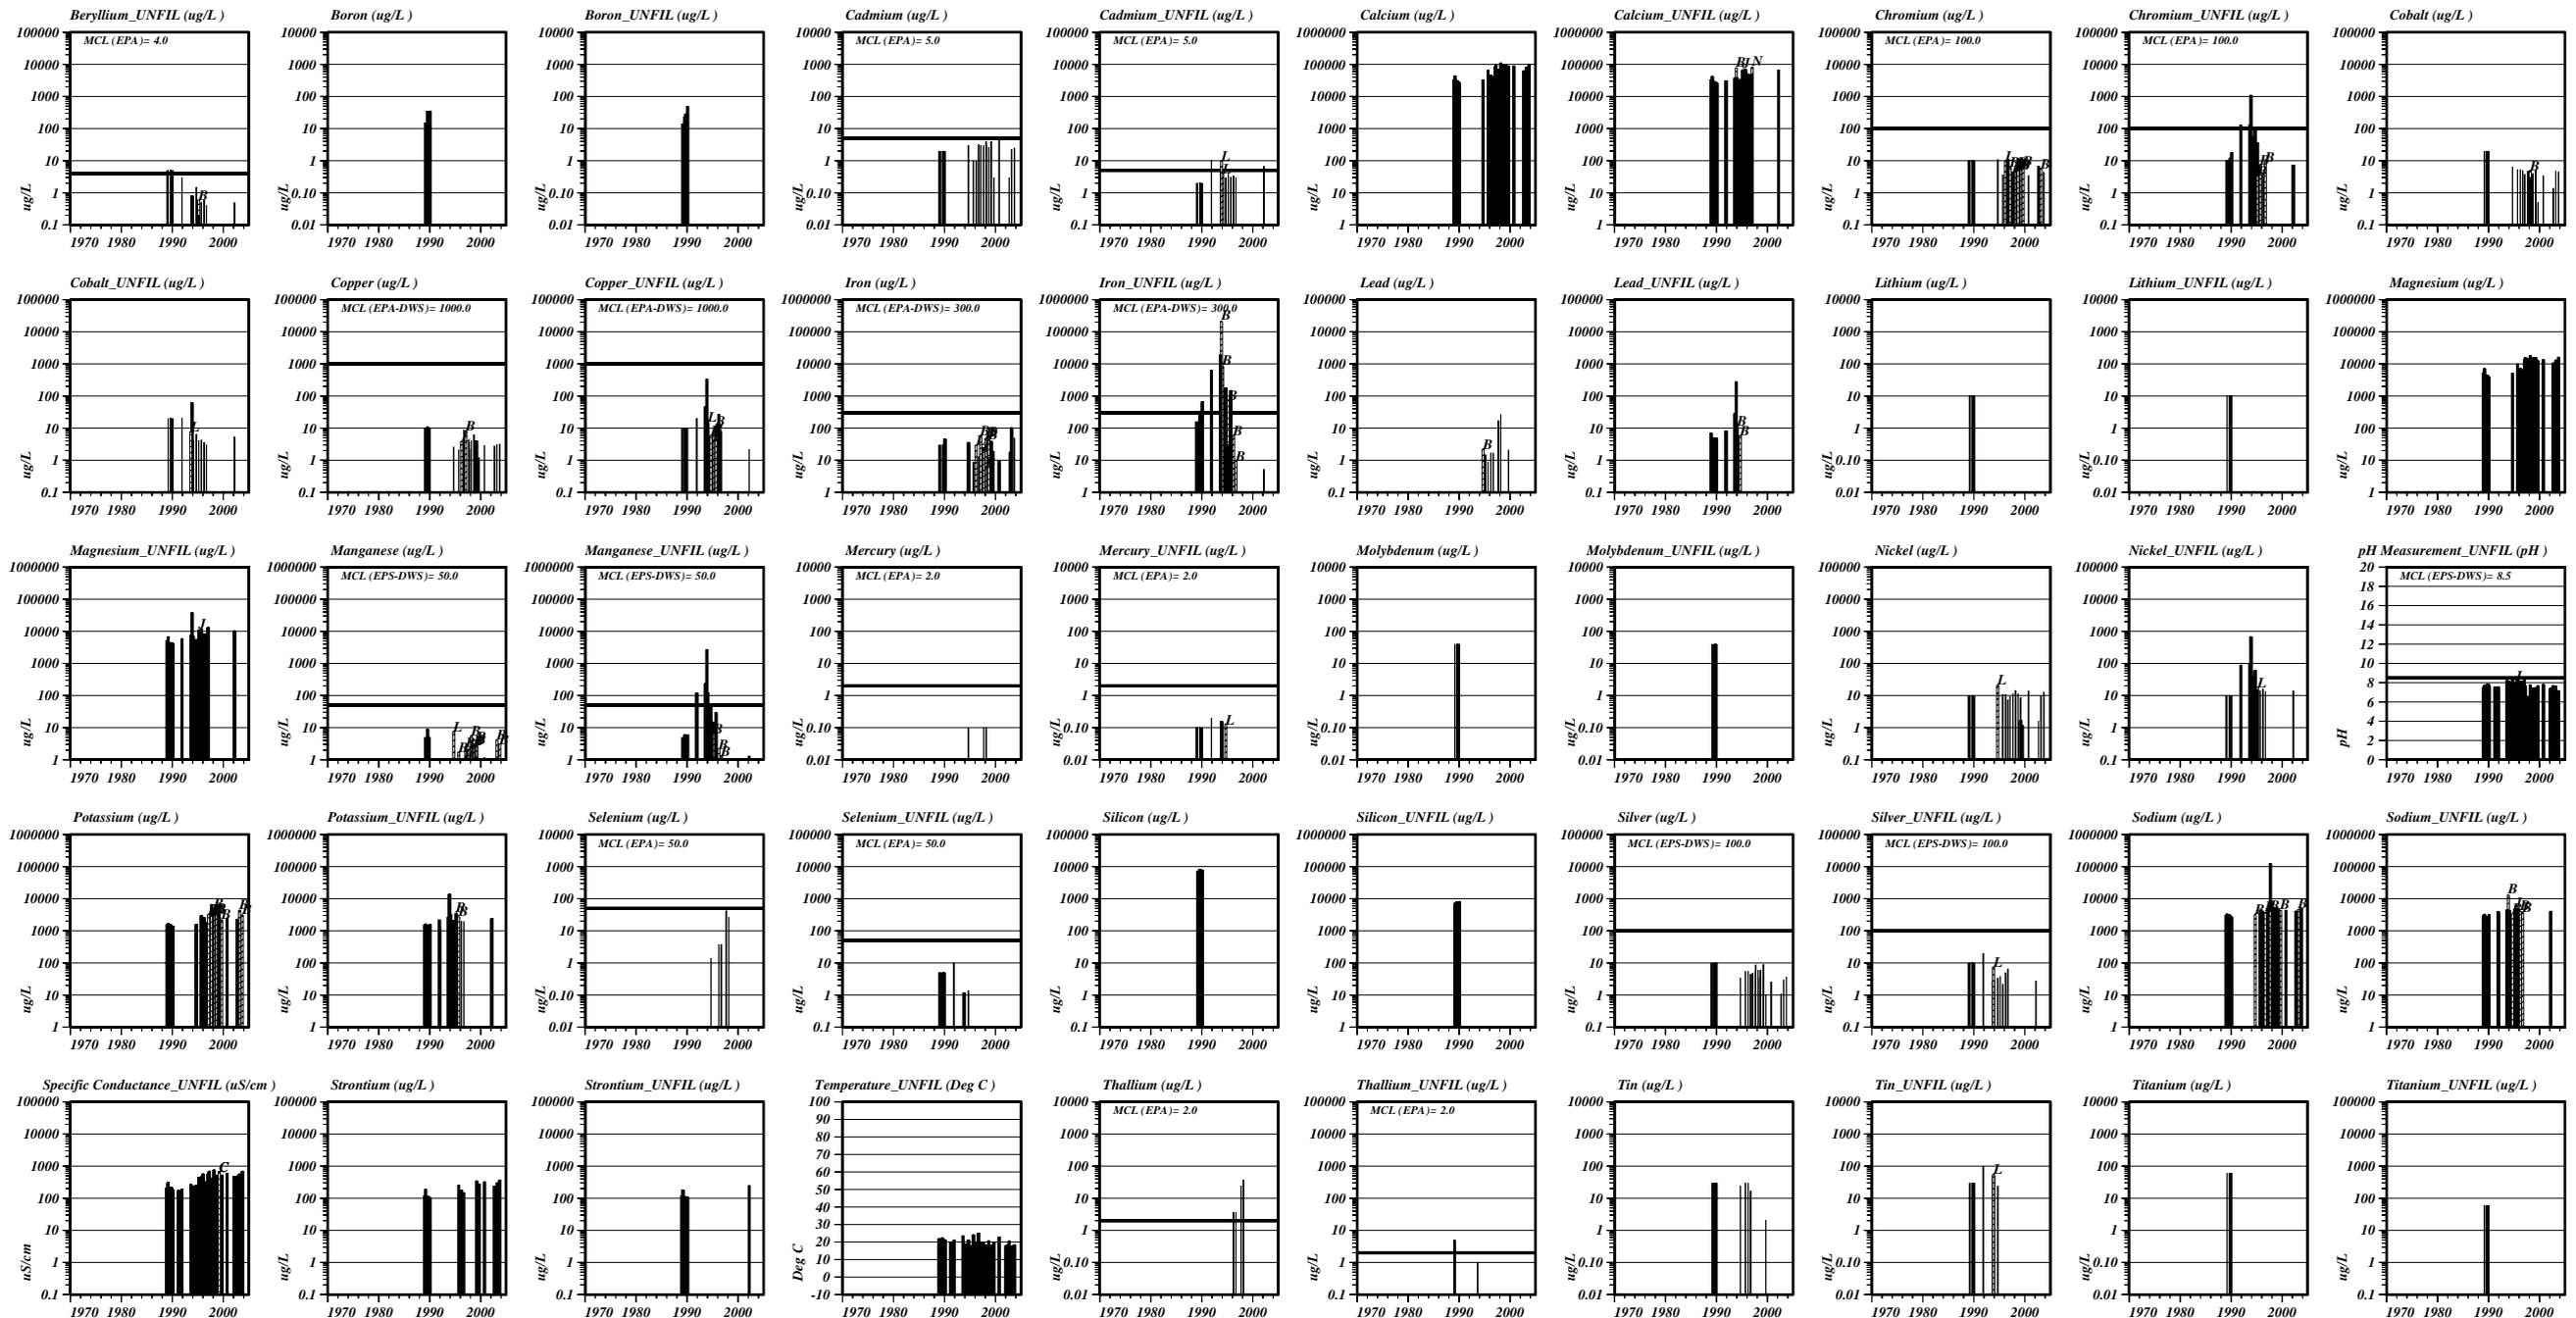


LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value:L=Value between IDL and CRQL (estimated):T=Tentatively identified compound:
EPA-IGR=EPA-Implementation Guidance for Radionuclides: WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit:THIN BARS=Value Below Detection Limit:HATCHED BARS=Value With Data Qualifier Flag

METALS & PHYSICAL PARAMETERS

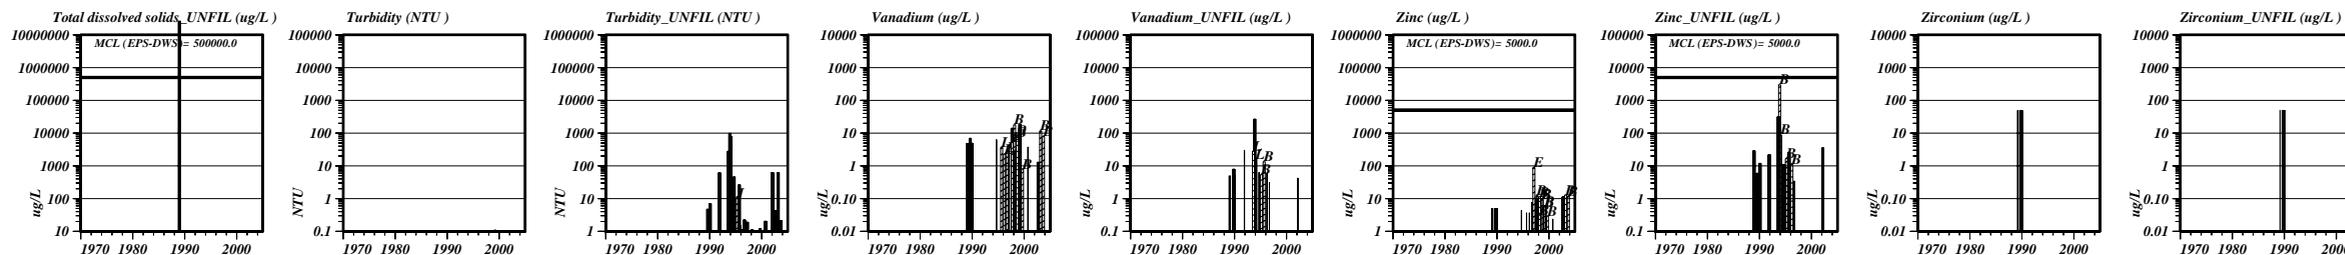


PEST/PCB, HERB, & DIOXINS

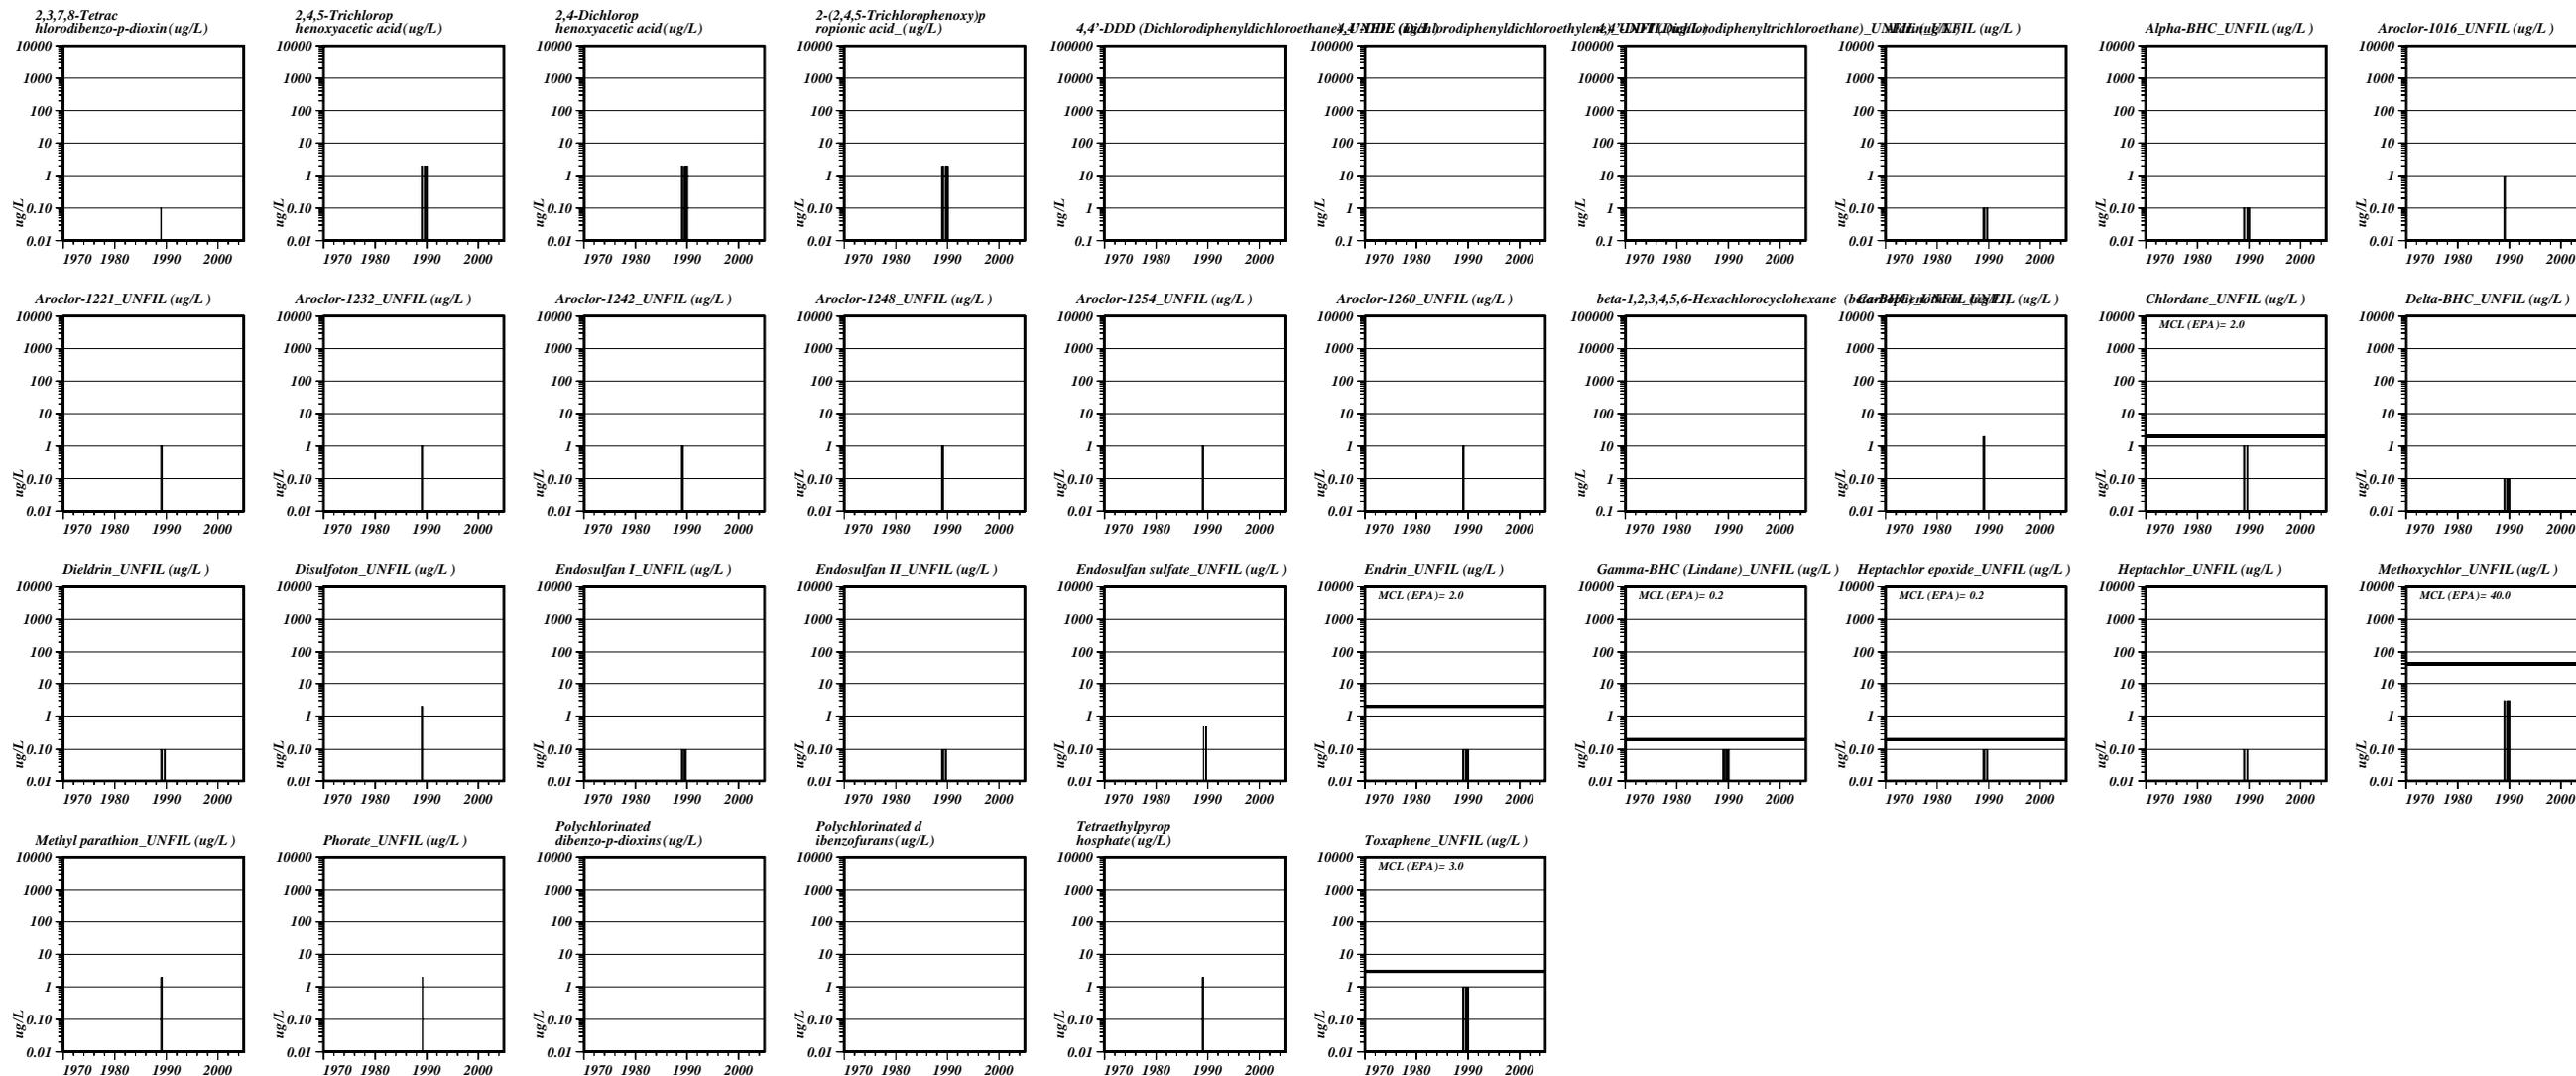

LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value; L=Value between IDL and CRQL (estimated); T=Tentatively identified compound; EPA-IGR=EPA-Implementation Guidance for Radionuclides; WAC=Washington Administrative Code;

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit; THIN BARS=Value Below Detection Limit; HATCHED BARS=Value With Data Qualifier Flag

GENCHEM & ORGANICS & GENORGANICS

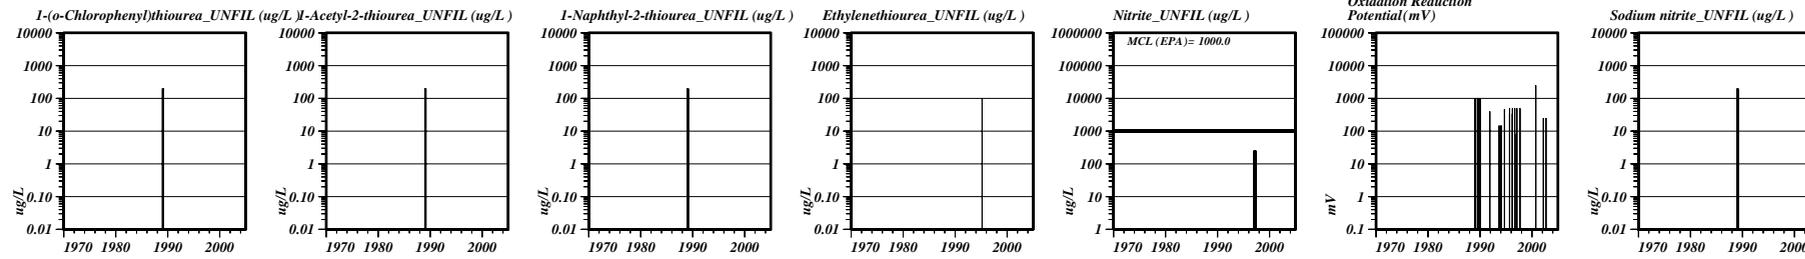

LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value:L=Value between IDL and CRQL (estimated):T=Tentatively identified compound:
 EPA-IGR=EPA-Implementation Guidance for Radionuclides: WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit:THIN BARS=Value Below Detection Limit:HATCHED BARS=Value With Data Qualifier Flag